PROPERTIES 80% goat hair, 15% nylon, 5% viscose Fiber 79" (6 ft, 7 in or 200 cm) Width 60 sq yd (50 sq m) approximate Roll Length approximately 300 lb per roll Weight 60 oz/sq yd (2,034 g/sq m) **Thickness** 0.2" (0.51 cm) Carpet 100% natural hessian (jute) **Backing** fusion bonded with polyvinyl chloride 2010 Waterford ACS-4099 sold with each order Adhesive **Metal Trim** available through distributor **Installation Direction** horizontal or vertical rib

PROPERTIES				
Fire Testing				
Flame Spread & Smoke Der	nsity			
ASTM E-84 Tunnel Test	15 FSI and	15 FSI and 195 SDI		
CAN/ULC S102 Tunnel Test	t 19.6 FSV a	nd 104.4 SDV		
Acoustical Rating	·			
ASTM C423	NRC 0.15			
One-third Octave Bands				
Colorfastness				
Light	AATCC-16	5		
Water	AATCC-107	5		
Rubbing (dry)	AATCC-165	4.5		
Rubbing (wet)	AATCC-165	4.5		
DuPont Tumble Method	Pilling 4-5	Fuzzing 2-3		

Warranty

Product is warranted free from defect for five years from installation at Waterford Carpet's discretion.


As with all natural fiber products, color variation is normal.


please call for larger samples

800 200 8120 tel | 800 430 8120 fax | tri-kes.com

Horizontal rib installation


Please note material installed with horizontal rib cannot turn outside 90° corners. The maximum radius that can be turned is a bullnose outside sheetrock corner. Another method to handle outside corners is to specify brushed aluminum 3/16 inch outside corner turn. Optional 3/16 inch J cap may be used in certain applications.

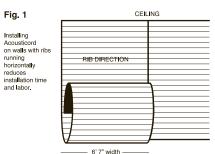



Vertical rib / railroaded installation

Please note material installed railroaded with vertical rib can make 90° turns. Run full sheet along ceiling line to keep horizontal seam below eye level. Optional to specify brushed aluminum 3/16 inch J cap for certain applications.

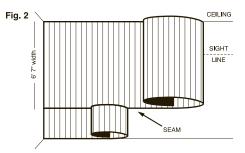

rer	ade from rapidly newable materials ED® MR 6		Covers concrete block	3	Minimal static- generating propensity	
	ow-emitting adhesives ED® EQ 4.1	6	Reduces noise	V	Velcro compatibility, exhibits slight pilling	
Hig	igh durability	4	Holes disappear once tacks are removed			



